

<u>Project Name:</u>			<u>Survey Segment:</u>			<u>Address:</u>				
<u>Homog.</u>	<u>Asbestos</u>	<u>Material Description</u>	<u>Area #</u>	<u>Results</u>	<u>Quantity</u>	<u>Location / *(Quantity)*</u>	<u>Condition</u>	<u>DamageType</u>	<u>Friability</u>	<u>ExposurePot.</u>
176	ND	Skim Coat None Detected	Smooth on Wallboard (Mtl #175) 2nd Floor		330	Sq.Ft. Throughout Space: S Walls *330* U	Good	None	Friable	Low
176B	ND	Skim Coat None Detected	Smooth on Wallboard (Mtl #175) 2nd Floor (Split Layer: Drywall-Pink)		330	Sq.Ft. Throughout Space: S Walls *330* U	Good	None	Friable	Low
176C	ND	Skim Coat None Detected	Smooth on Wallboard (Mtl #175) 2nd Floor (Split Layer: Mastic-Off-White)		330	Sq.Ft. Throughout Space: S Walls *330* U	Good	None	Friable	Low
<u>Length: 3 ft. Width: 1 ft. Height: 7 ft. Area: 3 sq.ft</u>										
<u>Floor: Floor Tile Wall: Plaster Ceiling: Plaster</u>										
<u>Ash Debris: No Notes:</u>										
<u>2: 2A-101B Fire Closet</u>			<u>113</u>	<u>NEG</u>	Plaster	42 Sq.Ft. Throughout Space: *42* U	Good	None	Non-Friable	Low
Smooth White Over Coarse Gray [Old Mtl #317]										
142	NEG	Baseboard Black w/ Brown Adhesive (Old Mtl #322)			5 Lin.Ft. Throughout Space: *5* U		Good	None	Non-Friable	Low
153	1-5%	Vinyl Floor Tile 9x9 Chrysotile Gray & Lt Gray Marble Pattern w/ Black Mastic			3 Sq.Ft. Throughout Space: *3* U		Good	None	Non-Friable	Low
153B	1-5%	Vinyl Floor Tile 9x9 Chrysotile Gray & Lt Gray Marble Pattern w/ Black Mastic (Split Layer: Mastic-Black)			3 Sq.Ft. Throughout Space: *3* U		Good	None	Non-Friable	Low

<u>Project Name:</u>			<u>Survey Segment:</u>			<u>Address:</u>			
Building 200			A: Building 200			4150 Clement, San Francisco, CA 94121			
<u>Homog.</u>	<u>Asbestos</u>	<u>Material Description</u>	<u>Quantity</u>	<u>Location / * (Quantity)*</u>		<u>Condition</u>	<u>DamageType</u>	<u>Friability</u>	<u>ExposurePot.</u>
<u>Area #</u>	<u>Results</u>								
<u>2:2A-102 Entry to Restroom</u>									
101	NEG	Ceiling Tile, Laid-In 2' x 2' w/ Pinholes & Light Texture [Old Mtl #301]	28	Sq.Ft. Throughout Space: *28* ¹		Good	None	Friable	Low
106	POS	Vinyl Floor Tile 12x12 Beige w/ Blue and White Streaks & Black Mastic [Old Mtl #304] 1-5% Chrysotile in black mastic	28	Sq.Ft. Throughout Space: *28* ¹		Good	None	Non-Friable	Low
113	NEG	Plaster Smooth White Over Coarse Gray [Old Mtl #317]	186	Sq.Ft. Throughout Space: *186* ¹		Good	None	Non-Friable	Low
114	NEG	Baseboard Beige w/ Beige/White Adhesive [Old Mtl #308]	16	Lin.Ft. Throughout Space: *16* ¹		Good	None	Non-Friable	Low

<u>Project Name:</u>			<u>Survey Segment:</u>		
<u>Homog.</u>	<u>Asbestos</u>	<u>Material Description</u>	<u>Quantity</u>	<u>Location / *(Quantity)*</u>	<u>Condition</u> <u>DamageType</u> <u>Friability</u> <u>ExposurePot.</u>
					<i>Length: 12 ft. Width: 10 ft. Height: 10 ft. Area: 120 sq.ft Floor: Ceramic Tile Wall: Plaster Ceiling: Ceiling Tile Ash Debris: No Notes:</i>
2: 2A-102A Restroom					
101	NEG	Ceiling Tile, Laid-In 2' x 2' w/ Pinholes & Light Texture [Old Mtl #301]	108 Sq.Ft.	Throughout Space: *108*□	Good None Friable Low
110	ND	Ceiling Tile, Laid-In None Detected 2' x 2' w/ Parallel Fissures & Random Pinholes	12 Sq.Ft.	Throughout Space: Various Locations *12*□	Good None Friable Low
113	NEG	Plaster Smooth White Over Coarse Gray [Old Mtl #317]	440 Sq.Ft.	Throughout Space: *440*□	Good None Non-Friable Low
121	POS	Adhesive Mirror	5 Sq.Ft.	Throughout Space: 2 Mirrors on E Wall at SE Corner *5*□	Good None Non-Friable Low
130	POS	Ceramic Wall Tile Adhesive and Grout 4" Off-white (Old Mtl #318)	176 Sq.Ft.	Throughout Space: *176*□	Good None Non-Friable Low
138	ND	Ceramic Floor Tile Adhesive and Grout None Detected 1" Tan w/ Brown Specks	120 Sq.Ft.	Throughout Space: *120*□	Good None Non-Friable Low
138B	ND	Ceramic Floor Tile Adhesive and Grout None Detected 1" Tan w/ Brown Specks (Split Layer: Grout-White)	120 Sq.Ft.	Throughout Space: *120*□	Good None Non-Friable Low
138C	ND	Ceramic Floor Tile Adhesive and Grout None Detected 1" Tan w/ Brown Specks (Split Layer: Plaster-Off-White)	120 Sq.Ft.	Throughout Space: *120*□	Good None Non-Friable Low

<u>Project Name:</u>			<u>Survey Segment:</u>			<u>Address:</u>				
<u>Honog.</u>	<u>Asbestos</u>	<u>Material Description</u>	<u>Area #</u>	<u>Results</u>	<u>Quantity</u>	<u>Location / *(Quantity)*</u>	<u>Condition</u>	<u>DamagType</u>	<u>Friability</u>	<u>ExposurePot.</u>
						<i>Length: 22 ft. Width: 16 ft. Height: 10 ft. Area: 352 sq.ft</i>				
						<i>Floor: Carpet Wall: Wallboard</i>				
						<i>Ash Debris: No Notes:</i>				
<u>2: 2A-103 Reception</u>										
101	NEG	Ceiling Tile, Laid-In 2' x 2' w/ Pinholes & Light Texture [Old Mtl #301]			352 Sq.Ft. Throughout Space: *352*↑		Good	None	Friable	Low
104	ND	Wallpaper Adhesive None Detected Clear Yellow			220 Sq.Ft. Throughout Space: E Wall *220*↑		Good	None	Non-Friable	Low
105	NEG	Baseboard Gray w/ Beige/White Adhesive (Old Mtl #303)			76 Lin.Ft. Throughout Space: *76*↑		Good	None	Non-Friable	Low
115	ND	Carpet Adhesive None Detected Tan			352 Sq.Ft. Throughout Space: *352*↑		Good	None	Non-Friable	Low
177	ND	Gypsum Wallboard System None Detected No Skim 2nd Floor			675 Sq.Ft. Throughout Space: *675*↑		Good	None	Friable	Low
177B	ND	Gypsum Wallboard System None Detected No Skim 2nd Floor (Split Layer: Texture-Off-White)			675 Sq.Ft. Throughout Space: *675*↑		Good	None	Friable	Low

<u>Project Name:</u>			<u>Survey Segment:</u>			<u>Address:</u>		
Building 200			A: Building 200			4150 Clement, San Francisco, CA 94121		
<u>Homog. Asbestos Area #</u>	<u>Asbestos Results</u>	<u>Material Description</u>	<u>Quantity</u>	<u>Location / *(Quantity)*</u>	<u>Condition</u>	<u>Damage Type</u>	<u>Friability</u>	<u>Exposure Pot.</u>
				<i>Length: 7 ft. Width: 3 ft. Height: 10 ft. Area: 21 sq.ft</i>				
				<i>Floor: Ceramic Tile Wall: Plaster</i>				
				<i>Asb Debris: No Notes:</i>				
2: 2A-171A Restroom								
113	NEG	Plaster	204	Sq.Ft. Throughout Space: *204*11	Good	None	Non-Friable	Low
				Smooth White Over Coarse Gray [Old Mt #317]				
121	POS	Adhesive Mirror	2	Sq.Ft. Throughout Space: S Wall, Center 2*11	Good	None	Non-Friable	Low
130	POS	Ceramic Wall Tile Adhesive and Grout	43	Sq.Ft. Throughout Space: *43*11	Good	None	Non-Friable	Low
				4" Off-white (Old Mt #318)				
138	ND	Ceramic Floor Tile Adhesive and Grout	21	Sq.Ft. Throughout Space: *21*11	Good	None	Non-Friable	Low
				None Detected 1" Tan w/ Brown Specks				
138B	ND	Ceramic Floor Tile Adhesive and Grout	21	Sq.Ft. Throughout Space: *21*11	Good	None	Non-Friable	Low
				None Detected 1" Tan w/ Brown Specks				
				(Split Layer: Grout-White)				
138C	ND	Ceramic Floor Tile Adhesive and Grout	21	Sq.Ft. Throughout Space: *21*11	Good	None	Non-Friable	Low
				None Detected 1" Tan w/ Brown Specks				
				(Split Layer: Plaster-Off-White)				




ENVIRONMENTAL
120 9th Street
Emeryville, CA 94608-2907
510.422.1003
eoh@enviro.com

Asbestos Material Location

SF VA Medical Center
Building : 200
Second Floor

Explanation:	
ACM Floor Tile Mastic	ACM Vinyl Floor Tile
ACM Vinyl Sheet Flooring (Assumed)	ACM Ceramic Floor Tile Adhesive And Grout (Assumed)
ACM Ceramic Wall Tile And Adhesive And Grout	ACM Vinyl Sheet Flooring Mastic
ACM Terrazzo Flooring (Assumed)	ACM Exterior Wall Stucco
ACM Skim Coat on Concrete	ACM Skim Coat on Wallboard
ACM Stair Tread (Assumed)	ACM Mirror Adhesive
ACM Window Frame Caulking	ACM Black Sink Undercoating

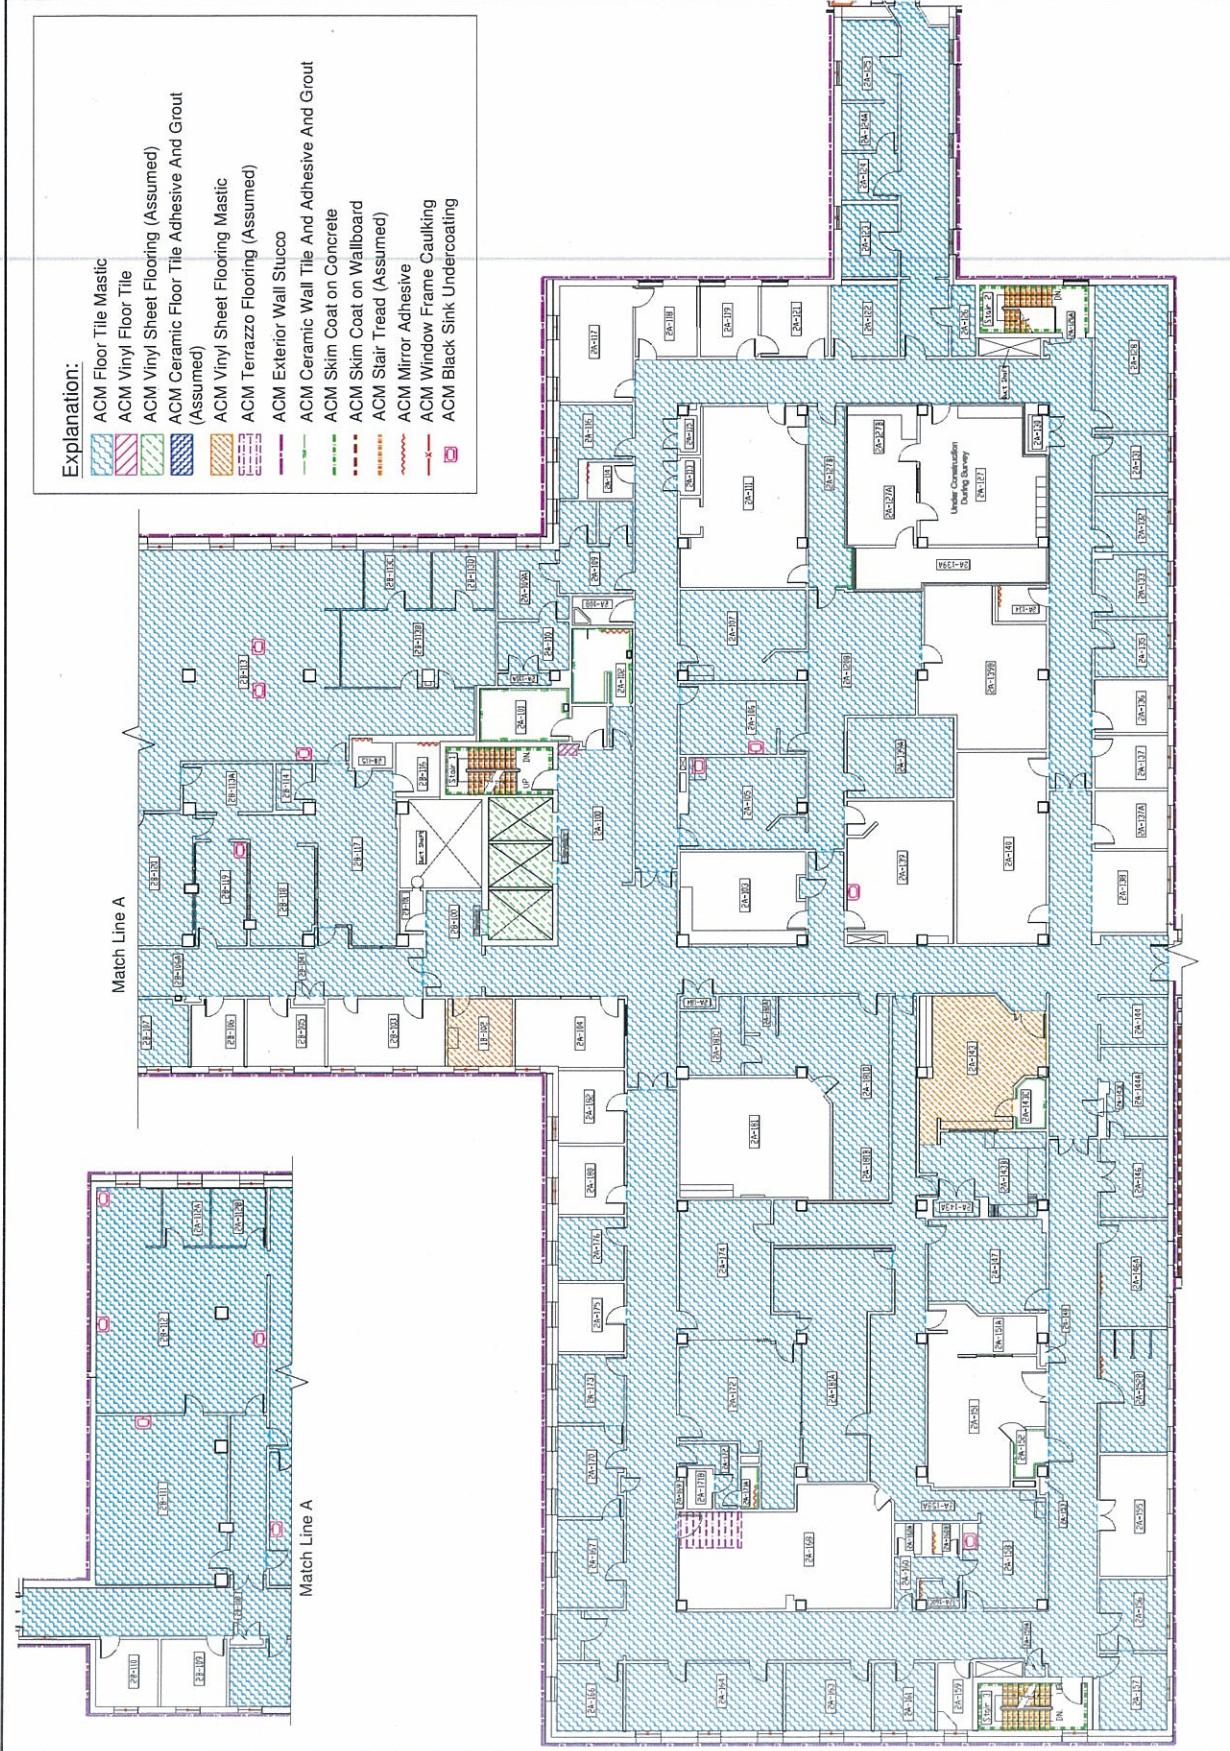

PROJECT NO.: 09B-21723
SHEET: Bldg200FP02.ML
DRAWN BY: S. Rahman
DATE: 12-14-09
REVISED BY:
DATE:
REVISED BY:
DATE: